


Toggle
SINGLE POLE


- 6.3mm tabs or Screw Terminals
- 10A, 250V a.c.

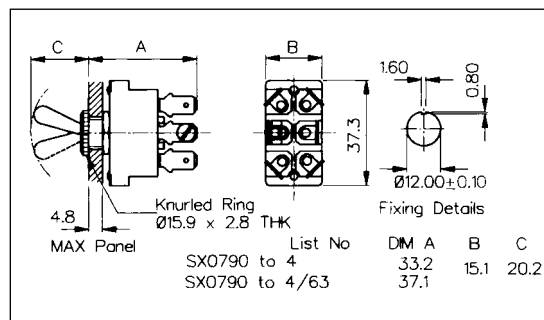

Single Pole List No.	Description	1	2	3
SX0790	Change-over. Centre off	ON	OFF	ON
SX0791	Change-over. Centre off One position biased off	ON	OFF	ON
SX0792	Change-over. Centre off Two position biased off	ON	OFF	ON
SX0793	Change-over Two positions only	ON	-	ON
SX0794	ON/OFF Two positions only	OFF	-	ON


Specification	SX0790 Series		
Terminations:	Screw Terminals		
Switching:	See table for types Slow Make, Slow Break		
Max. Rating:	10A, 250V a.c. 10A, 0-28V d.c. (non-reactive circuits)		
Contact Resistance:	<10mΩ		
Insulation Resistance:	>10 ³ MΩ		
Dielectric Strength:	>2.5kV a.c.		
Operating Temp. Range:	-20°C to +85°C		
Materials:			
Mouldings:	Glass Filled Polyester		
Tags:	Brass, Silver Plated		
Contacts:	Copper with Silver face		
Variants:	/63 (6.3mm tabs) - (except SX0791)		
Accessories:	SX0550 (see page 195)		
RoHS	Compliant		


Toggle

DOUBLE POLE



- 6.3mm tabs or Screw Terminals
- 10A, 250V a.c.

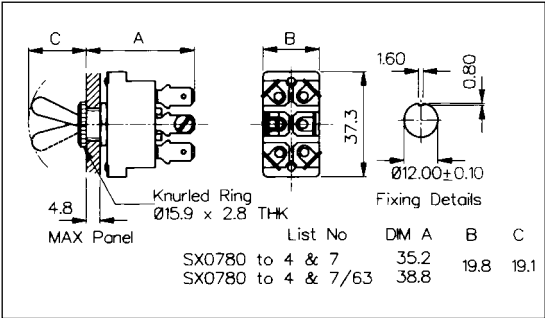

Double Pole List No.	Description	1 	2 	3 
SX0780	Change-over. Centre off	ON	OFF	ON
SX0782	Change-over. Centre off Two position biased off	ON	OFF	ON
SX0783	Change-over Two positions only	ON	-	ON
SX0784	ON/OFF Two positions only	OFF	-	ON
SX0787	Change-over. Two positions only biased to one position	ON	-	ON

Specification	SX0780 Series		
Terminations:	Screw Terminals		
Switching:	See table for types Slow Make, Slow Break		
Max. Rating:	10A, 250V a.c. 10A, 0-28V d.c. (non-reactive circuits)		
Contact Resistance:	<10mΩ		
Insulation Resistance:	>10 ³ MΩ		
Dielectric Strength:	>2.5kV a.c.		
Operating Temp. Range:	-20°C to +85°C		
Materials:			
Mouldings:	Glass Filled Polyester		
Tags:	Brass, Silver Plated		
Contacts/Terms:	Copper with Silver face		
Variants:	/63 (6.3mm tabs)		
Accessories:	SX0550 (see page 195)		
RoHS	Compliant		